
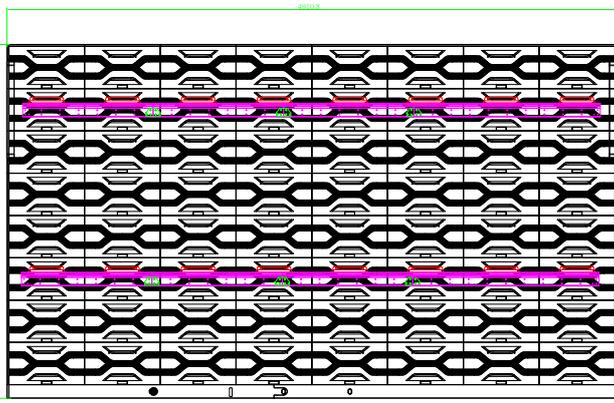


8	7	6	5	4	3	2	1	
					Signal	Date	Modification Items	Mdifier
					△	2021-08-XX		

Size Tolerance (mm)		138-inch all-in-one Display		Product Model			
0 < X ≤ 500	± 0.1	Material Code	Material Code	Design	Review	Weight	Proportion
500 < X ≤ 1000	± 0.2			Page No.	Total number	Version No.	
1000 < X ≤ 1500	± 0.4						
1500 < X ≤ 2000	± 0.5						

8	7	6	5	4	3	2	1
Signal		Date		Modify		Modifier	

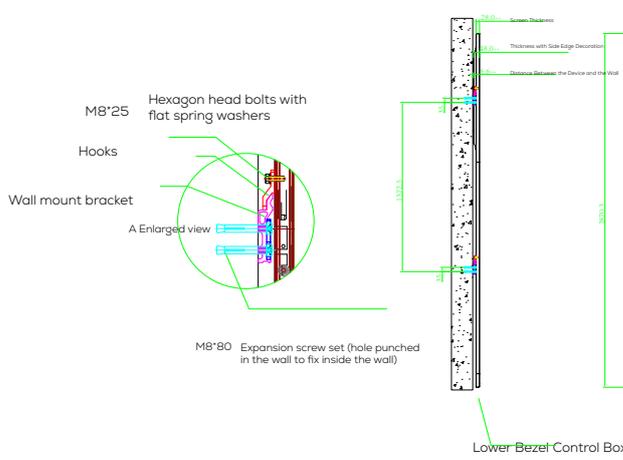

Installation Instructions:

1. Install the wall-mounting bracket:
 - a. According to the indicated wall-mounting bracket hole positions, confirm the positions of the drilling holes on the wall by combining with actual on-site measurements. Mark the positions on the wall based on height requirements. (For a 600x3 wall-mounting bracket, it is recommended to use 6 points; for a 600x2 wall-mounting bracket, it is recommended to use 4 points. Reserve other positions. Use a level to ensure the accuracy of the drilling points.)
 - b. Use an electric drill with an M10 drill bit to drill installation holes for M8x80 expansion bolts. The hole depth should be 10 mm, and the precision requirements should not exceed 1 mm. (If the drill bit is inclined and contacts built-in reinforcement parts, a re-drilled hole may be selected)
 - c. Install M8x80 expansion bolts into the drilled holes, ensuring the distance between the two bolts is 600 mm, and that wall-mounting brackets pair up.
 - d. Check if the mounting distance of the wall-mounting bracket is accurate. The criteria are: 1) level; 2) the distance between the two brackets if accurate. Tighten the adjustment screw to check if the bracket meets the requirements. If any inaccuracy is found, readjust before fixing the bolts.
2. Install the numbering box:
 - a. Route the inside connection lines and connect the screened signal lines and flexible flat cables (FFC).
 - b. Each standard box comes with five cable label plates. Fold the top and bottom into each other and adjust the position at will. Fix the label plate and insert it into the required hole on the numbering box. Attach the tags on the top left and bottom right corners of each faceplate.
3. Screen connection lines:

Connect the internal connection lines and link the power cables, signal cables, and FFC cables.
4. Module connection:

Refer to the user manual for details.

Wall mounted bracket assembly diagram



Wall mount installation diagram
165-inch all-in-one display